



# Acoustical Surfaces, Inc.

**SOUNDPROOFING, ACOUSTICS, NOISE & VIBRATION CONTROL SPECIALISTS**

123 Columbia Court North • Suite 201 • Chaska, MN 55318

(952) 448-5300 • Fax (952) 448-2613 • (800) 448-0121

Email: [sales@acousticalsurfaces.com](mailto:sales@acousticalsurfaces.com)

Visit our Website: [www.acousticalsurfaces.com](http://www.acousticalsurfaces.com)

---

---

**We Identify and *S.T.O.P.* Your Noise Problems**

**TEST REPORT**

OMEGA POINT  
LABORATORIES, INC.  
16015 Shady Falls Road  
Elmendorf, TX 78112  
(V) 210-635-8100  
(F) 210-635-8101  
800-966-5253  
[www.opl.com](http://www.opl.com)

**ASTM E84-03**

**SURFACE BURNING  
CHARACTERISTICS**

Report No. 16715 - 120249

2120-011 Pc# 99877001 Tempest

August 12, 2004

Prepared for:  
Interface Fabrics Group  
120 Gilboa Street  
East Douglas, MA 01516





# Acoustical Surfaces, Inc.

SOUNDPROOFING, ACOUSTICS, NOISE & VIBRATION CONTROL SPECIALISTS

123 Columbia Court North • Suite 201 • Chaska, MN 55318

(952) 448-5300 • Fax (952) 448-2613 • (800) 448-0121

Email: [sales@acousticalsurfaces.com](mailto:sales@acousticalsurfaces.com)

Visit our Website: [www.acousticalsurfaces.com](http://www.acousticalsurfaces.com)

## We Identify and S.T.O.P. Your Noise Problems

Report No. Report 16715 - 120249  
Interface Fabrics Group

Page 2 of 8  
August 12, 2004

### ABSTRACT

Test Specimen:	2120-011 Pc# 99877001 Tempest	
Test Standard:	ASTM E84-03	
Test Date:	July 29, 2004	
Test Sponsor:	Interface Fabrics Group	
Test Results:	FLAME SPREAD INDEX	= 5
	SMOKE DEVELOPED INDEX	= 45

*This report and the information contained herein is for the exclusive use of the client named herein. Omega Point Laboratories, Inc. authorizes the client to reproduce this report only if reproduced in its entirety. The description of the test procedure, as well as the observations and results obtained, contained herein are true and accurate within the limits of sound engineering practice. These results apply only for the specimens tested, and the manner tested, and may not represent the performance of other specimens from the same or other production lots nor of the performance when used in combination with other materials. The test specimen identification is as provided by the client and Omega Point Laboratories, Inc. accepts no responsibility for any inaccuracies therein. Omega Point select the specimen and has not verified the composition, manufacturing techniques or quality assurance procedures. This report does not imply certification of the product by Omega Point Laboratories, Inc. Any use of the Omega Point Laboratories name, any abbreviation thereof or any logo, mark, or symbol therefor, for advertising material must be approved in writing in advance by Omega Point laboratories, Inc. The client must have entered into and be actively participating in a Listing & Follow-up Service program. Products must bear labels with the Omega Point Laboratories Certification Mark to demonstrate acceptance by Omega Point Laboratories, Inc. into the Listing program.*

August 12, 2004

Eric G. Hutchinson  
E84 Operator

Reviewed and approved:

August 12, 2004

William E Fitch PE No. 55296





# Acoustical Surfaces, Inc.

**SOUNDPROOFING, ACOUSTICS, NOISE & VIBRATION CONTROL SPECIALISTS**

123 Columbia Court North • Suite 201 • Chaska, MN 55318

(952) 448-5300 • Fax (952) 448-2613 • (800) 448-0121

Email: [sales@acousticalsurfaces.com](mailto:sales@acousticalsurfaces.com)

Visit our Website: [www.acousticalsurfaces.com](http://www.acousticalsurfaces.com)

---

---

***We Identify and S.T.O.P. Your Noise Problems***

Report No. Report 16715 - 120249  
Interface Fabrics Group

Page 3 of 8  
August 12, 2004

## I. INTRODUCTION

This report describes the results of the ASTM E84-03 Standard Test Method for SURFACE BURNING CHARACTERISTICS OF BUILDING MATERIALS, a method for determining the comparative surface burning behavior of building materials. This test is applicable to exposed surfaces, such as ceilings or walls, provided that the material or assembly of materials, by its own structural quality or the manner in which it is tested and intended for use, is capable of supporting itself in position or being supported during the test period.

The purpose of the method is to determine the relative burning behavior of the material by observing the flame spread along the specimen. Flame spread and smoke density developed are reported, however, there is not necessarily a relationship between these two measurements.

“The use of supporting materials on the underside of the test specimen may lower the flame spread index from that which might be obtained if the specimen could be tested without such support. This method may not be appropriate for obtaining comparative surface burning behavior of some cellular plastic materials. Testing of materials that melt, drip, or delaminate to such a degree that the continuity of the flame front is destroyed, results in low flame spread indices that do not relate directly to indices obtained by testing materials that remain in place.”

This test method is also published under the following designations:

ANSI 2.5

NFPA 255

UBC 8-1 (42-1)

UL 723

**This standard should be used to measure and describe the properties of materials, products, or assemblies in response to heat and flame under controlled laboratory conditions and should not be used to describe or appraise the fire hazard or fire risk of materials, products, or assemblies under actual fire conditions. However, results of this test may be used as elements of a fire risk assessment which takes into account all of the factors which are pertinent to an assessment of the fire hazard of a particular end use.**





# Acoustical Surfaces, Inc.

**SOUNDPROOFING, ACOUSTICS, NOISE & VIBRATION CONTROL SPECIALISTS**

123 Columbia Court North • Suite 201 • Chaska, MN 55318

(952) 448-5300 • Fax (952) 448-2613 • (800) 448-0121

Email: [sales@acousticalsurfaces.com](mailto:sales@acousticalsurfaces.com)

Visit our Website: [www.acousticalsurfaces.com](http://www.acousticalsurfaces.com)

---

---

**We Identify and S.T.O.P. Your Noise Problems**

Report No. Report 16715 - 120249  
Interface Fabrics Group

Page 4 of 8  
August 12, 2004

## II PURPOSE

The ASTM E84-03 (25 foot tunnel) test method is intended to compare the surface flame spread and smoke developed measurements to those obtained from tests of mineral fiber cement board and select grade red oak flooring. The test specimen surface (18 inches wide and 24 feet long) is exposed to a flaming fire exposure during the 10 minute test duration, while flame spread over its surface and density of the resulting smoke are measured and recorded. Test results are presented as the computed comparisons to the standard calibration materials.

The furnace is considered under calibration when a 10 minute test of red oak decking will pass flame out the end of the tunnel in five minutes, 30 seconds, plus or minus 15 seconds. Mineral fiber cement board forms the zero point for both flame spread and smoke developed indexes, while the red oak flooring smoke developed index is set as 100.

## III DESCRIPTION OF TEST SPECIMEN

Specimen Identification: 2120-011 Pc# 99877001 Tempest

Date Received: 7/23/2004

Date Prepared: 7/23/2004

Conditioning (73°F & 50% R.H.): 6 days

Specimen Width (in): 24

Specimen Length (ft): 24

Specimen Thickness: 0.0170-in.

Material Weight: N/A oz./sq. yd

Total Specimen Weight: 2.10-lbs.

Adhesive or coating application rate: N/A

### Mounting Method:

The specimen was supported on 1/4 in steel rods and 2 inch galvanized hexagonal wire mesh.

### Specimen Description:

The Test specimen was described by the client as the "100% Recycled Polyester Panel Fabric." The specimen consisted of (2) 12-ft. long x 24-in. wide x 0.0170-in. thick, 100% recycled polyester panel fabric. The fabric was (Lt. Blue) in color, and was identified as 2117-011 and PC# 99877001 Tempest.





# Acoustical Surfaces, Inc.

**SOUNDPROOFING, ACOUSTICS, NOISE & VIBRATION CONTROL SPECIALISTS**

123 Columbia Court North • Suite 201 • Chaska, MN 55318

(952) 448-5300 • Fax (952) 448-2613 • (800) 448-0121

Email: [sales@acousticalsurfaces.com](mailto:sales@acousticalsurfaces.com)

Visit our Website: [www.acousticalsurfaces.com](http://www.acousticalsurfaces.com)

---

---

## We Identify and **S.T.O.P.** Your Noise Problems

Report No. Report 16715 - 120249  
Interface Fabrics Group

Page 5 of 8  
August 12, 2004

### IV TEST RESULTS

The test results, computed on the basis of observed flame front advance and electronic smoke density measurements are presented in the following table. In recognition of possible variations and limitations of the test method, the results are computed to the nearest number divisible by five, as outlined in the test method.

*While no longer a part of this standard test method, the Fuel Contributed Value has been computed, and may be found on the computer printout sheet in the Appendix.*

Test Specimen	Flame Spread Index	Smoke Developed Index
Mineral Fiber Cement Board	0	0
Red Oak Flooring	90	100
<b>2120-011 Pc# 99877001 Tempest</b>	<b>5</b>	<b>45</b>

The data sheets are included in the appendix. These sheets are actual print-outs of the computerized data system which monitors the ASTM E84 apparatus, and contain all calibration and specimen data needed to calculate the test results.

### V. OBSERVATIONS

During the test, the specimen was observed to behave in the following manner: The polyester fabric ignited at 0:04 (min:sec.). Flaming drops began to fall from the fabric at 0:08 (min:sec.). The floor of the apparatus ignited at 7:30 (min:sec.) The test continued for the 10:00 duration. After the test burners were turned off, a 60 second afterflame was observed.

After the test specimen was observed to be damaged as follows:

The fabric was consumed from 0-ft. - 12 -ft. Light discoloration was observed to the fabric from 13-ft. - 24-ft.





# Acoustical Surfaces, Inc.

**SOUNDPROOFING, ACOUSTICS, NOISE & VIBRATION CONTROL SPECIALISTS**

123 Columbia Court North • Suite 201 • Chaska, MN 55318

(952) 448-5300 • Fax (952) 448-2613 • (800) 448-0121

Email: [sales@acousticalsurfaces.com](mailto:sales@acousticalsurfaces.com)

Visit our Website: [www.acousticalsurfaces.com](http://www.acousticalsurfaces.com)

---

---

***We Identify and S.T.O.P. Your Noise Problems***

Report No. Report 16715 - 120249  
Interface Fabrics Group

Page 6 of 8  
August 12, 2004

## APPENDIX

### E84 Data Sheets





# Acoustical Surfaces, Inc.

**SOUNDPROOFING, ACOUSTICS, NOISE & VIBRATION CONTROL SPECIALISTS**

123 Columbia Court North • Suite 201 • Chaska, MN 55318

(952) 448-5300 • Fax (952) 448-2613 • (800) 448-0121

Email: [sales@acousticalsurfaces.com](mailto:sales@acousticalsurfaces.com)

Visit our Website: [www.acousticalsurfaces.com](http://www.acousticalsurfaces.com)

---

---

**We Identify and S.T.O.P. Your Noise Problems**

## ASTM E84 DATA SHEETS

Client: INTERFACE FABRICS

Date: 7/29/04

Time: 04:01 PM

Test Number 6

Project Number: 16715-120249

Operator EH/AF

Specimen ID: "2120-011 PC# 99877001 TEMPEST". 100% RECYCLED  
POLYESTER PANEL FABRIC SPECIMEN WAS SUPPORTED  
BY RODS AND WIRE.

## TEST RESULTS

**FLAMESPREAD INDEX 5**

**SMOKE DEVELOPED INDEX 45**

## SPECIMEN DATA ...

Time to Ignition (sec): 4

Time to Max FS (sec): 20

Maximum FS (feet): 1.0

Time to 980 °F (sec): Never Reached

Max Temperature (°F): 486

Time to Max Temperature (sec): 574

Total Fuel Burned (cubic feet): 48.68

FS\*Time Area (ft\*Min): 10.2

Smoke Area (%A\*min): 44.1

Fuel Area (°F\*min): 4188.8

Fuel Contributed Value: 0

Unrounded FSI: 5.3

## CALIBRATION DATA ...

Time to Ignition of Last Red Oak (sec): 49

Red Oak Smoke Area (%A\*min): 101.60

Red Oak Fuel Area (°F\*min): 8153

Glass Fiber Board Fuel Area (°F\*min): 5040





# Acoustical Surfaces, Inc.

**SOUNDPROOFING, ACOUSTICS, NOISE & VIBRATION CONTROL SPECIALISTS**

123 Columbia Court North • Suite 201 • Chaska, MN 55318

(952) 448-5300 • Fax (952) 448-2613 • (800) 448-0121


Email: [sales@acousticalsurfaces.com](mailto:sales@acousticalsurfaces.com)

Visit our Website: [www.acousticalsurfaces.com](http://www.acousticalsurfaces.com)

**We Identify and S.T.O.P. Your Noise Problem**

Report No. Report 16715 - 120249

Interface Fabrics Group

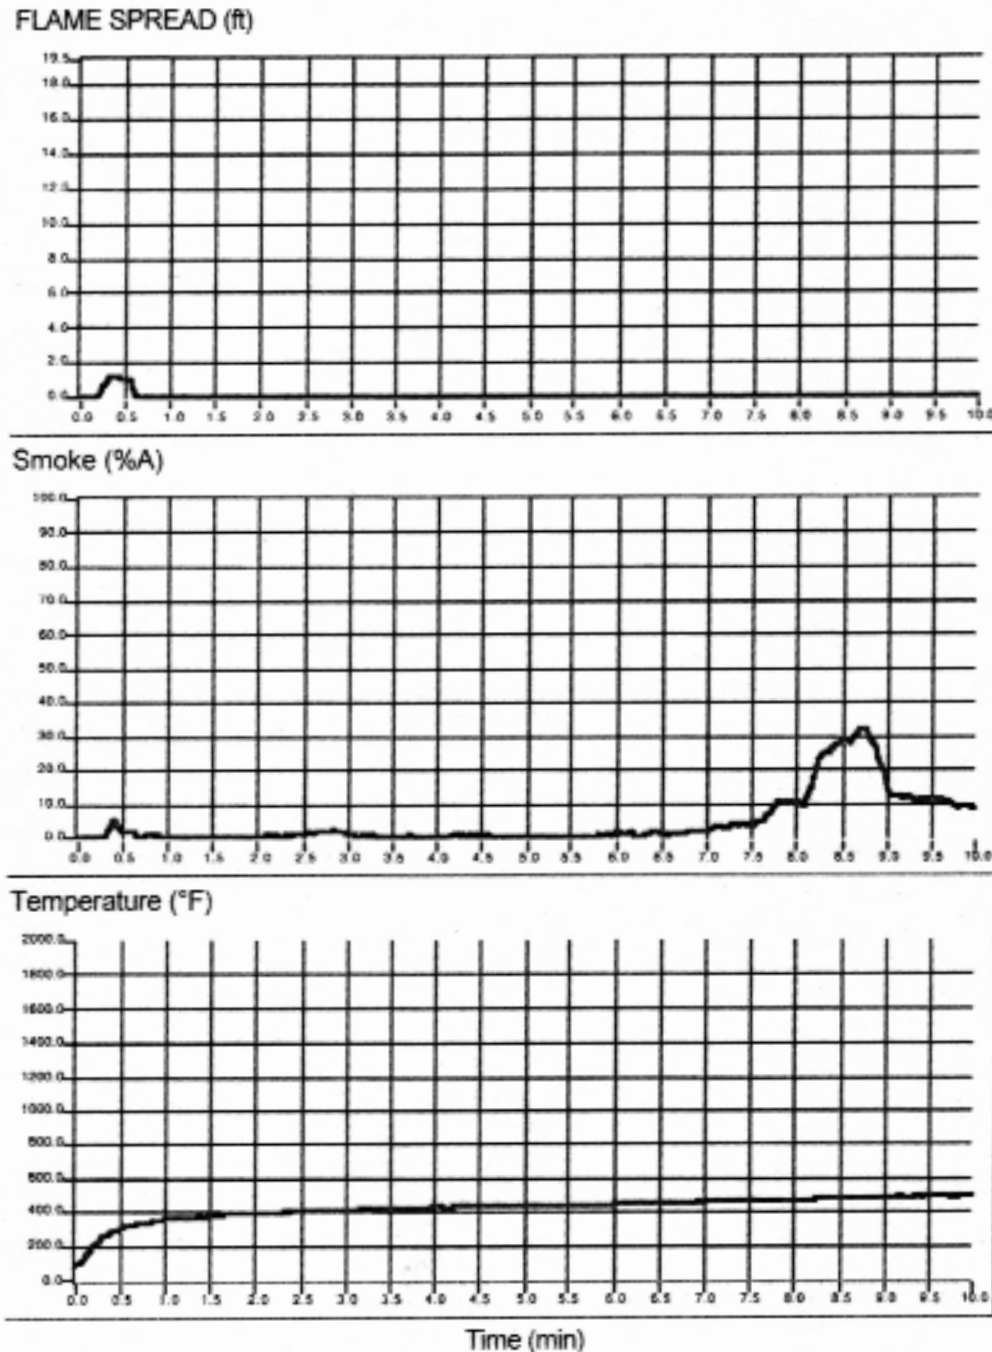

- Soundproofing Products • Sonex™ Ceiling & Wall Panels • Sound Control Curtains • Equipment Enclosures • Acoustical Baffles & Banners • Solid Wood & Veneer Acoustical Ceiling & Wall Systems
- Professional Audio Acoustics • Vibration & Damping Control • Fire Retardant Acoustics • Hearing Protection • Moisture & Impact Resistant Products • Floor Impact Noise Reduction
- Sound Absorbers • Noise Barriers • Fabric Wrapped Wall Panels • Acoustical Foam (Egg Crate) • Acoustical Sealants & Adhesives • Outdoor Noise Control • Assistive Listening Devices
- OSHA, FDA, ADA Compliance • On-Site Acoustical Analysis • Acoustical Design & Consulting • Large Inventory • Fast Shipment • No Project too Large or Small • Major Credit Cards Accepted